
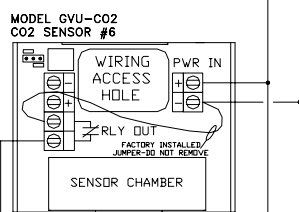
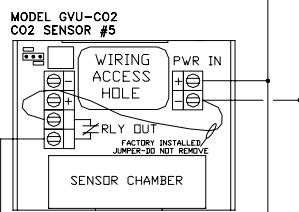
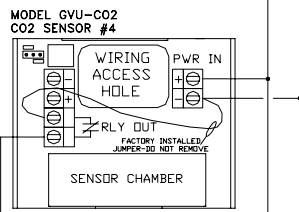
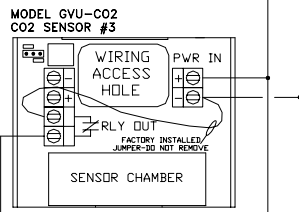
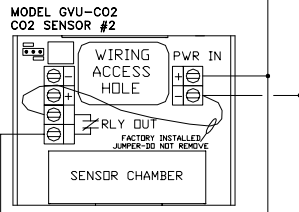


GVU-12 CO2 MONITOR FIELD WIRING


FIELD WIRING DIAGRAM

TOXALERT Gvu-CO, Gvu-NO2 AND Gvu-VOC SENSORS CAN BE USED IN PLACE OF OR IN COMBINATION WITH TOXALERT Gvu-CO2 CARBON DIOXIDE SENSORS. REFER TO APPLICABLE DATA SHEETS AND SCHEMATICS.

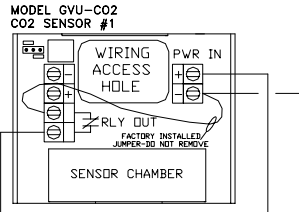

Wire Gauge (AWG)	Max Cable Length (feet)	BELDEN NUMBER
18	1,300	8770
16	2,000	8618
14	3,000	83753
12	4,400	83803

SENSOR WIRE GAUGE AND LENGTH
(IF CABLE IS NOT RUN IN METAL CONDUIT USE SHIELDED CABLE)

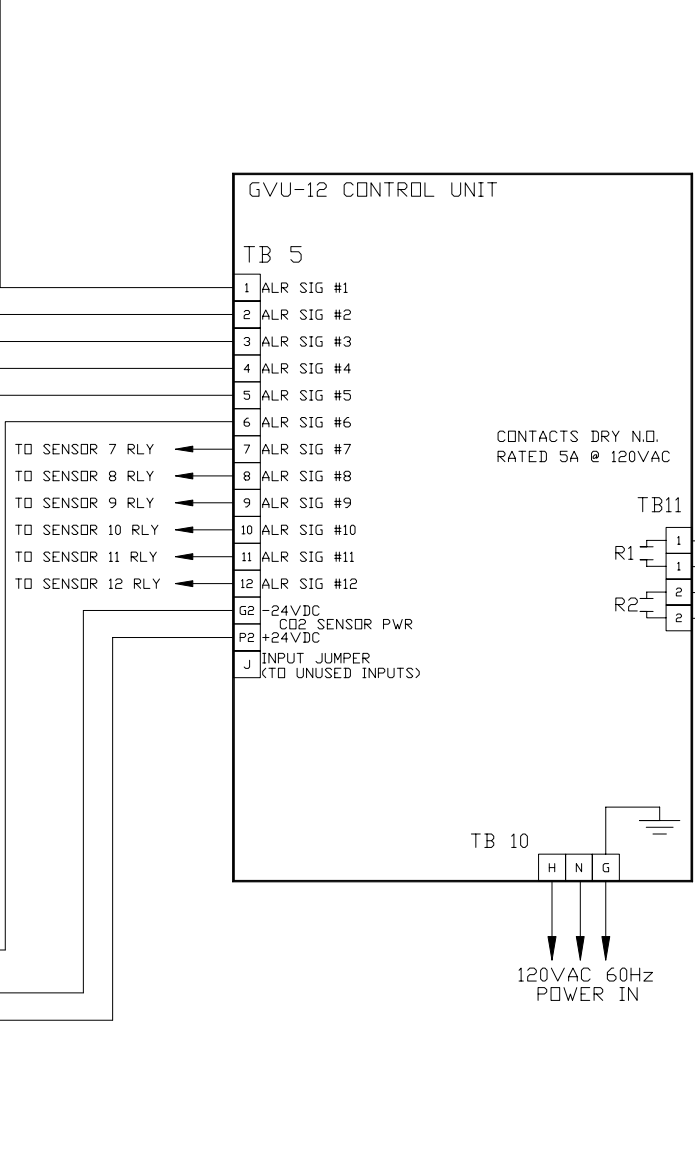

TOXALERT
INTERNATIONAL
GAS DETECTION SYSTEMS
www.toxalert.com
P.O. BOX 159 MOUND, MN. 55364
(952)472-4541

ENG: *	ENG. BY *
CONTR: *	DWN. BY CSS
A.	B.
C.	D.

GVU-12 CO2 MONITOR, FIELD WIRING

*
*

SHEET * DATE: 3/15/06 DWG. NO. SECTION 2 STD.